



PRODUCT SERVICE DIVISION
TECHNICAL SERVICES DEPARTMENT
SERVICE BULLETIN

SB NO. **05958**

PAGE 1 OF 1

ISSUED: 12-12-94
REISSUED: 03-28-00

SUBJECT: **INTERMITTENT & NO-RUN UNITS**
UNIT(S): **COMPACT POWER - SEE BELOW**
DATE CODES: **9445 AND EARLIER**

When one of the units described below experiences an "intermittent" or "no-run" condition, the problem is more likely with the Brush Box than the Switch. Make certain the following fix is in place before replacing the Switch.

UNITS AFFECTED: Some units with these date codes have already been modified with a bead of solder connecting the Brush Terminals and need not be updated. Any of the following units brought in for repair that do not already have the solder bead connecting the Brush Terminals should be repaired per the following procedure using **Brush Pair Kit 389025-00!**

2802 2820 2840 2852 2861 2862 2870 2872 2874 2894 2898

DW961 DW962 DW964 DW971 DW972 DW973 DW974 DW976 DW979 DW991 DW994 DW991
DW996 D964K2-04 D972K2-04 D974KQ-04 D974K2-04 D991K-04 D994KQ-04

PROCEDURE: Repairs to these products must be performed at static-free work stations per SB 05955.

If there is no solder bead connecting the Brush Terminals, replace the Brush Box Assemblies with the part number shown in the chart. Each of the assemblies shown contains two complete Brush Holder Assemblies including Brushes and Leads. Test tool for proper operation.

